

Circulate to: ☐ Sales Manager ☐ Accounting ☒ Service Manager ☒ Technician ☒ Parts Manager

## High-Pressure Hydraulic Hose Length Causing Intermittent Pressure Fault

### Scope

Worldwide

### Models Affected

Models Covered	Cummins Serial Number
All CMD/Mercury QSD 2.8L Generation 1 Diesel Axius Products All CMD/Mercury QSD 4.2L Generation 1 Diesel Axius Products	88401303 and above

### Situation

The power steering high-pressure hose, Mercury Marine part number 32-8M2019262, installed between the Axius power steering pump and the Axius high-pressure filter, can increase resonance in pump output pressure. This resonance may result in intermittent pump output pressure faults and alarms. The length of the hose is the primary cause of the resonance.

The high-pressure hose, part number 32-8M2019262 measures 38.1 cm (15 in.) end to end (seating surface to seating surface).

The high-pressure hose contained in kit part number 32-8M0065248 measures 101.6 cm (40 in.) end to end.

### Correction

If you receive complaints of intermittent pump output pressure faults and alarms, examine the length of the high-pressure hose between the power steering pump and the high-pressure filter. The hose measurement is made end to end (seating surface to seating surface).

#### **If the 38.1 cm (15 in.) hose is installed:**

Order and replace with high-pressure hose kit, part number 32-8M0065248.

**NOTE:** Ensure the hose fitting and area around the fitting is clean before removal to avoid contamination. Use only a lint-free cloth to clean the fitting area before removal. Keep replacement hose sealed in the shipping bag until time of replacement.

### Warranty

**United States and Canada:** Mercury Marine will credit the dealer for the cost of parts and labor.

Submit a warranty claim through your normal warranty-processing channel listing:

- MerCruiser engine serial number
- For hose inspection and replacement use:
  - Labor: 1.0 hour
  - Flat rate code: SB10
- Part code: 815
- Failure code: 40

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE.


This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.

## Old Parts

- **United States and Canada:** Scrap
- **Outside the United States and Canada:** Follow instructions issued by the Marine Power International office or by an authorized Marine Power Distributor.

## Hose Inspection and Routing


### Incorrect Hose

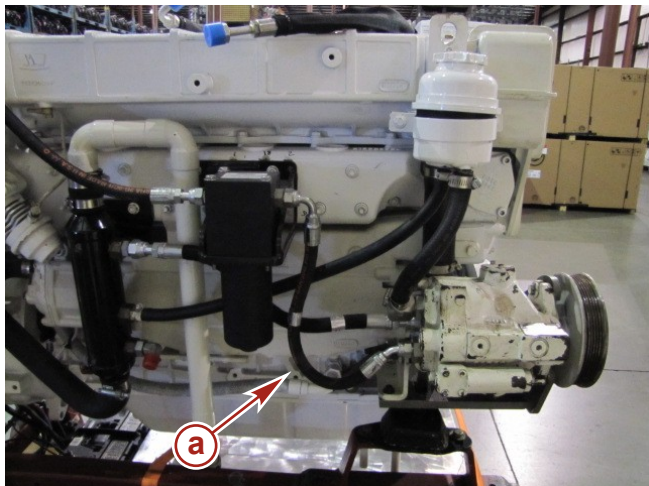

- a -** Requires part number 32-8M0065248 to be ordered and installed

49946

### Correct Hose Routing

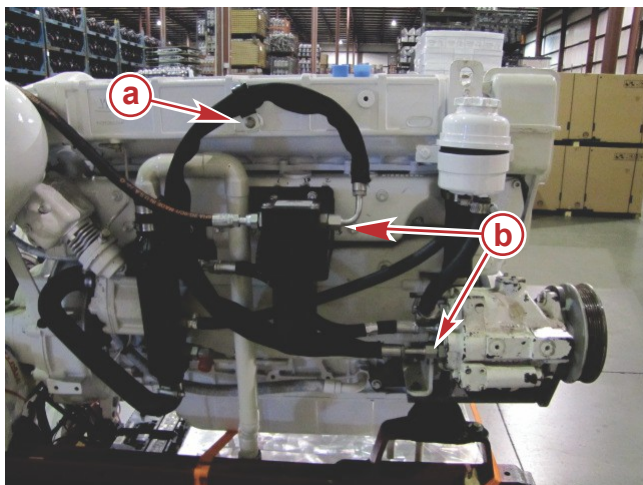

- a -** Hose clamp and bolts  
**b -** Hose swivel fittings

49947

Description	Nm	lb-in.	lb-ft
Bolts (M8 x 12)	19		14
Hose swivel fittings	27		20

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.